


B.


RECORD CARD FOR SECULAR MONUMENTS.

(N.B.—Detail of special interest is to be entered here, but described fully on a separate card.)

1. Name and situation of Monument (with owner's Name and Address). Lower House Farm in Olchon Valley just over  $\frac{3}{4}$  mile S.S.E. of Church.
2. General appearance: (a) No. of storeys. 2 attic.  
(b) Building materials. Ribbles stone.  
(c) Roofs. Stone slates.


3. Historical development (with dates and small sketch plan).  
A 16th c. house. In modern times additions have been built on against S. side.

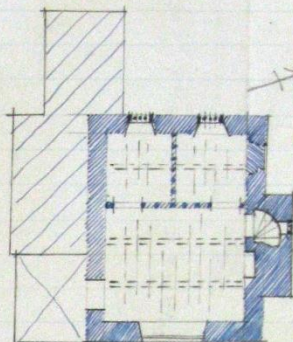

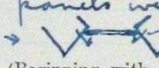4. Special features (if any). Nearly all windows have diamond mullions & during latter part of 17th c. small glazed panels were inserted in some lights by pinning in  Nail pinning in light. with leads.
5. Elevations: (Beginning with the main front, and mentioning, in the following order:—(a) Walls; (b) Gables; (c) Doors; (d) Windows; (e) Chimneys; (f) Rainwater heads and pipes.)

East Elev. Gabled. Attic door has square wood frame (3 light) formerly had diamond mullions now missing.

West Elev. Gabled. Exposed timbers. On ground floor a two 5 light windows with square wood frames & diamond mullions. In several lights narrow glass leaded panels (17th c) have been inserted & tacked in. Above windows on flagstone labels.

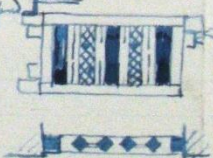

North Elev. Projecting stack incorporating semi circular stone staircase - staircase portion has roof brought down over it as lean-to. Other side of stack, which is rectangular, is stepped & stack has projecting cap. The two diagonal stone detached shafts have been re-built. There is a 3 light window to staircase uniform with those on W elev & also partly glazed. On ground floor is a blocked window with flagstone label for 1st floor a 5 light diamond mullioned window.

6. Grounds: (a) Gardens; (b) Outbuildings; (c) Statuary, sundials, etc.

South Elev. Doorway has flagstone hood supported on 2 shaped moulded brackets (wood) one of which perished from rot. Remainder of this elevation concealed by modern additions.



County. Herefordshire

Parish. Llanveynoe


Sub-Commission. Severn.

No. of Monument. 13

7. Interior: (Disposition of rooms, if original, giving fittings as they occur (see list), beginning with the ground floor, following with the basement, and working up to the attics:



(8) Rubble and floors.

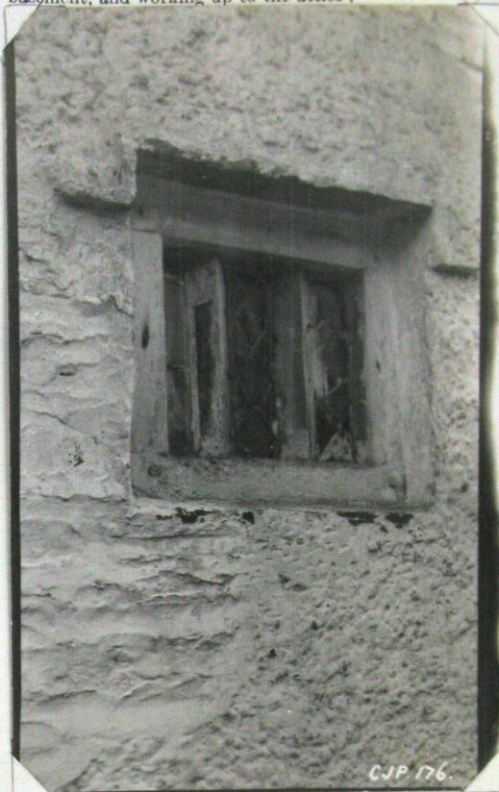

(9) Plasterwork on internal walls.

(10) Roofs and beams (internal).

(11) Screens.

(12) Tapestries.

(13) Miscellaneous (e.g., carving, ironwork, locks, &c.).

The ground floor partitions are all framed with wood panels & heads of all door frames are segmental. Ground floor ceilings have exposed stop chamfered beams & ceiling joists.

8. Condition: Poor.

9. Visited by (with dates): A.T. Phillips. May. 1927.

10. Bibliography:

11. No. of Ordnance Sheet (6-in.): XLIII. N.E.

12. Signature of Investigator. A.T. Phillips



CJP. 175.

ith the basement, and working up to the attics ;

