

B.


RECORD CARD FOR SECULAR MONUMENTS.

(N.B.—Detail of special interest is to be entered here, but described fully on a separate card.)

1. Name and situation of Monument (with owner's Name and Address). Brass Knoll Farm in Olchon Valley 1/2 mile S of Church.
2. General appearance: (a) No. of storeys. 2 attic
(b) Building materials. Stone rubble. (3ft thick)
(c) Roofs. Stone Slates.

3. Historical development (with dates and small sketch plan).

Consists of one wing of a 16th c. house.
The remainder of house now destroyed
a modern addition having been
built on in its place.

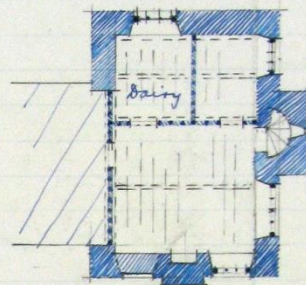

4. Special features (if any). The whole of the partitioning have wood panels between the framing.
Inside shutters to windows in dairy on staircase.

5. Elevations: (Beginning with the main front, and mentioning, in the following order:—(a) Walls; (b) Gables; (c) Doors; (d) Windows; (e) Chimneys; (f) Rainwater heads and pipes.)

E. Elev. Gabled. Rectangular outside slant with weathered sides. There are four 3light windows — 2 on ground + 2 on 1st floor — with heavy chamfered frames + mod. mullions. Frames are set back 7 inches behind face gwall + opening above frame is spanned by a chamfered lintol over which, again, there is a flag stone label of shape  in every case. One of ground floor windows is blocked.

N. Elev. Rectangular projection containing semi-circular staircase (of stone with thick slab oak treads) with lean-to roof + having in same a 2light window at 1st floor level. At ground floor to E of projection is a 4light window + at 1st floor a 3light window; while to W of staircase projection there is a 3light window at ground floor level. (all these windows are uniform with those on E already described.) The base gwall is battered + the rafters feet wall plate are exposed.

6. Grounds: (a) Gardens; (b) Outbuildings; (c) Statuary, sundials, etc.

W. Elev. Gabled with exposed timbers. To ground floor is a 3light + on 1st floor a 3light or 2light window all uniform with those already described. At attic level is a 5light unglazed window of which only one of the diamond shaped mullions now remains.

S. Elev. Largely concealed by modern addition within which may be seen the exposed framed partition the upper part of which has wattle + plaster while lower story has ~~stop chamfered~~ posts with wood panels between.

P.T.O.

County.

Herefordshire

Parish.

Llanveynoe

Sub-Commission.

Secular

No. of Monument.

(6)

7. Interior: (Disposition of rooms, if original, giving fittings as they occur (see list), beginning with the ground floor, following with the basement, and working up to the attics; staircases in the same manner.)

Fittings:

(Reminder list).

(1) Ceilings.

(2) Cupboards (fixed).

(3) Doors and Overdoors.

(4) Fireplaces and Mantel-pieces.

(5) Glass.

(6) Paintings.

(7) Panelling.

(8) Parquetry and floors

(9) Plasterwork on internal walls.

(10) Roofs and beams (internal).

(11) Screens.

(12) Tapestries.

On ground floor all partitions are wood panelled as described under "S. Elevation". The framing above all doors is segmental & there are 3 (17Kc?) battened doors hung on strap hinges. Ceilings of all ground floor rooms have chamfered beams with 'spur' stops & exposed joints, the latter in the large room being stop chamfered. The dairy window has inside battened shutters hung on strap hinges & staircase window has one piece shutters hung on staples. ~~Cills of windows~~ Window boards are of 5" oak slabs. On 1st floor ceilings have chamfered beams with moulded stops & plain exposed joints. There is an old wood beam over modern fireplace in bedroom. Window boards similar to those downstairs.



8. Condition: Fair.

9. Visited by (with dates): A.T. Phillips. May 1927.

10. Bibliography:

11. No. of Ordnance Sheet (6-in.): XLIII. N.E.

12. Signature of Investigator. A.T. Phillips

