

B.

RECORD CARD FOR SECULAR MONUMENTS.

(N.B.—Detail of special interest is to be entered here, but described fully on a separate card.)

1. Name and situation of Monument (with owner's Name and Address). *Old House Barn*

3/4 mile N.E. of Church.


2. General appearance: (a) No. of storeys. *1* placement under E bay.

(b) Building materials. *Timber frame on stone plinth & stone rubble walls.*

(c) Roofs. *Stone slates.*

3. Historical development (with dates and small sketch plan).

A 17th c. barn. Probably c. 1700 the most E bay was re-built with stone walls with 'half basement' under. In modern times the S. wall of remainder has been re-built in stone & modern addition built on at W end.

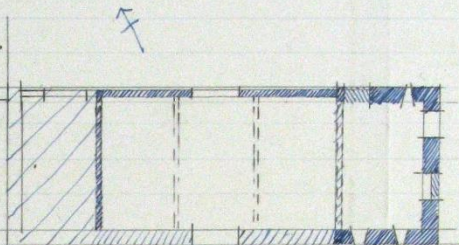

4. Special features (if any).

5. Elevations: (Beginning with the main front, and mentioning, in the following order:—(a) Walls; (b) Gables; (c) Doors; (d) Windows; (e) Chimneys; (f) Rainwater heads and pipes.)

N. Elev. *E end. rubble stone. Remainder timber framed on stone plinth. Upper panels of framing are filled with wide interlaced laths. In E wall is a blocked door & in timber framed part is a double door.*

E. Elev. *Stone rubble, exposed timbers & gabled. There is a blocked window on ground floor level.*

S. Elev. *In E bay are two slit windows & the post of a cross partition is exposed. Remainder re-built in stone.*

W. Elev. *Gabled weather boarded. Lower part hidden by late 18th c. addition.*

6. Grounds: (a) Gardens; (b) Outbuildings; (c) Statuary, sundials, etc.

Immediately N.E. of this barn is another barn which has been re-built but which incorporates a 17th c. timber framed wall & gable at its N.E. end.

County. *Herefordshire*

Parish. *Llanveynoe*

Sub-Commission. *Sander*

No. of Monument. *5*

7. Interior: (Disposition of rooms, if original, giving fittings as they occur (see list), beginning with the ground floor, following with the basement, and working up to the attics: staircases in the same manner.)


Fittings:

(Reminder list).

- (1) Ceilings.
- (2) Cupboards (fixed).
- (3) Doors and Overdoors.
- (4) Fireplaces and Mantel-pieces.
- (5) Glass.
- (6) Paintings.
- (7) Panelling.
- (8) Parquetry and floors.
- (9) Plasterwork on internal walls.
- (10) Roofs and beams (internal).
- (11) Screens.
- (12) Tapestries.
- (13) Miscellaneous (e.g., carving, ironwork, locks, &c.).



The two cross-partitions are of form →
while two roof trusses are of
type →

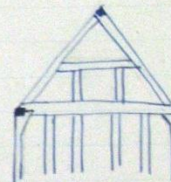

8. Condition: Poor.

9. Visited by (with dates): A.T. Phillips. May 1927

10. Bibliography:

11. No. of Ordnance Sheet (6-in.): XLIII. N.E.

12. Signature of Investigator. A.T. Phillips

