

(21). Upper Limebrook Farm, house, 2¾ m. S.W. of the church, is of mediæval origin, the E. wing having three crutch-trusses. The W. wing is probably a 16th-century addition, when the early wing was divided into two storeys. Inside the building is some 17th-century panelling.

**B.**

(21)


**RECORD CARD FOR SECULAR MONUMENTS.**

(N.B.—Detail of special interest is to be entered here, but described fully on a separate card.)

1. Name and situation of Monument (with owner's Name and Address). *Upper Limebrook Farm  
2¾ miles S.W. of the Church*


2. General appearance: (a) No. of storeys. *Two + basement.*  
 (b) Building materials. *Plastered timber framing on rubble plinth, rubble*  
 (c) Roofs. *Stone slates.*

3. Historical development (with dates and small sketch plan).  
*E. of the main chimney stack are two western bays of a mediæval house, incorporated in a 16<sup>th</sup> century rebuild, when the chimney stack was inserted, a first floor built into that part of the early building that which was preserved, and the existing western end of the house either added or rebuilt. The S.E. chimney stack, and the eastern end of the house <sup>are boarded</sup>*

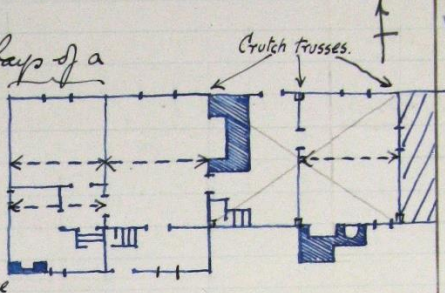

4. Special features (if any) *are modern additions.*

5. Elevations: (Beginning with the main front, and mentioning, in the following order:—(a) Walls; (b) Gables; (c) Doors; (d) Windows; (e) Chimneys; (f) Rainwater heads and pipes.)  
*The N<sup>W</sup> fronts have been covered with rough-cast. The S. wall has been refaced partly with rubble, partly rough cast.*



V.J.H.597.

6. Grounds: (a) Gardens; (b) Outbuildings; (c) Statuary, sundials, etc.

P.T.O.

(89,102). Wt. 33,349—47. 500. 12/13. A.&E.W.  
 (97,153). " 5021—53. 6000. 5/14. "

County. *Hereford III*  
 Parish. *Wigmore*  
 Sub-Commission.  
 No. of Monument.

7. Interior: (Disposition of rooms, if original, giving fittings as they occur (see list), beginning with the ground floor, following with the basement, and working up to the attics; staircases in the same manner.)

**Fittings:**

(Reminder list).

(1) Ceilings

(2) Cupboards (fixed).

(3) Doors and Overdoors.

(4) Fireplaces and Mantel-pieces.

(5) Glass.

(6) Paintings.

(7) Panelling.

(8) Parquetry and floors.

(9) Plasterwork on internal walls.

(10) Roofs and beams (internal).

(11) Screens.

(12) Tapestries.

(13) Miscellaneous (e.g., carving, ironwork, locks, &c.).

The interior has stop-chamfered ceiling beams & exposed timber framing.

The room W. of the main chimney stack has some moulded panelling of mid 17<sup>th</sup> date

E. of the main chimney stack are three 'crotch' trusses, enclosing two wooden bays (15'8" and 9'6"). Timber framed partition walls of 16<sup>th</sup> c. date have been inserted in the crotches; that at the E. end having a blocked window at first floor level.



8. Condition: Fair.

9. Visited by (with dates): G.E. Chambers 20.4.32

10. Bibliography:

11. No. of Ordnance Sheet (6-in.): VI SW.

12. Signature of Investigator: G.E. Chambers.